



Screen P6 F.R.




P/600-300

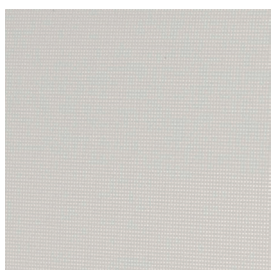


P/601-300

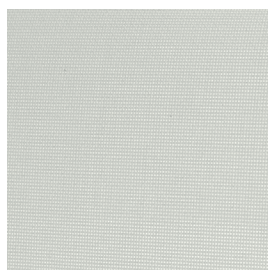


P/602-300

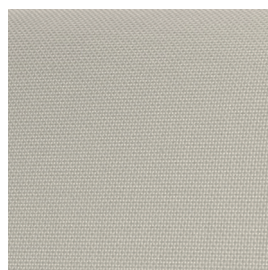

P/606-300

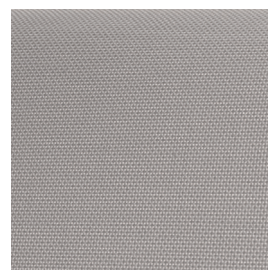

P/607-300

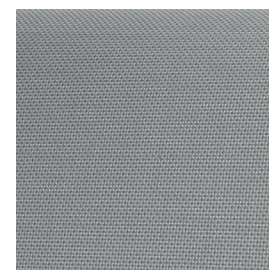

P/608-300



Ref.	 cm	 mm	 g/m²								 %						 TOT INT		 WARP	 WEFT
P/600-300	300	0,43	325	25% PL 75% PVC	Classe 1 (I), NFPA 701(US), BS (GB)	Low Transparent	FUNGISTATIC, GREENGUARD, OEKO-TEX, REACH	8	heat	No	2.00	21	68	11	19	51	0,42	94	135	110
P/601-300	300	0,43	325	25% PL 75% PVC	Classe 1 (I), NFPA 701(US), BS (GB)	Low Transparent	FUNGISTATIC, GREENGUARD, OEKO-TEX, REACH	8	heat	No	2.00	21	68	11	19	51	0,42	94	135	110
P/602-300	300	0,43	325	25% PL 75% PVC	Classe 1 (I), NFPA 701(US), BS (GB)	Low Transparent	FUNGISTATIC, GREENGUARD, OEKO-TEX, REACH	8	heat	No	2.00	22	58	20	18	43	0,48	95	99	102
P/606-300	300	0,43	325	25% PL 75% PVC	Classe 1 (I), NFPA 701(US), BS (GB)	Low Transparent	FUNGISTATIC, GREENGUARD, OEKO-TEX, REACH	8	heat	No	2.00	17	47	36	16	36	0,60	95	99	102
P/607-300	300	0,43	325	25% PL 75% PVC	Classe 1 (I), NFPA 701(US), BS (GB)	Low Transparent	FUNGISTATIC, GREENGUARD, OEKO-TEX, REACH	8	heat	No	2.00	15	53	32	14	55	0,70	94	99	102
P/608-300	300	0,43	325	25% PL 75% PVC	Classe 1 (I), NFPA 701(US), BS (GB)	Low Transparent	FUNGISTATIC, GREENGUARD, OEKO-TEX, REACH	8	heat	No	2.00	11	42	47	10	44	0,52	95	99	102

All coefficients have a possible tolerance of +/- 5%
 Attention: colour shades may vary slightly from one dye lot to another

	Width		Composition		Health certification		IMO - Fabrics for marine industry		Solar reflection		Light absorption		Sound absorption
	Thickness		Flame retardant		Colour fastness		Openess factor		Solar absorption		G tot Type C - GLASS		Warp - Weft N5 cm
	Weight		Transparency		Sealable		Solar transmission		Light transmission		UV reduction		

MAINTENANCE HANDLE THE FABRIC WITH CARE, USING CLEAN DRY HANDS. DO NOT USE SOLVENTS OR ANY ABRASIVE SUBSTANCES THAT MAY DAMAGE THE FABRIC. WHEN CLEANING WINDOWS THE BLIND MUST BE RAISED TO AVOID ANY DIRECT OR INDIRECT SPRAY OF CLEANING PRODUCTS. REMOVE THE DUST WITH A VACUUM CLEANER OR USING COMPRESSED AIR, AVOID PULLING OR STRETCHING FABRIC. ONLY FOR PVC COATED PRODUCTS, CLEAN WITH A DAMP CLOTH OR A SPONGE DIPPED IN SOAPY WATER IF NECESSARY. RINSE WITH CLEAN WATER. DO NOT RUB. LEAVE THE BLIND DOWN UNTIL COMPLETELY DRY.