



Blackout TR F.R.




TR/501

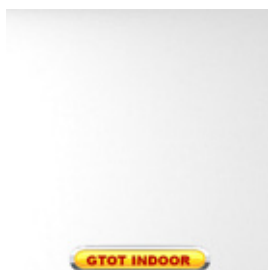


TR/502

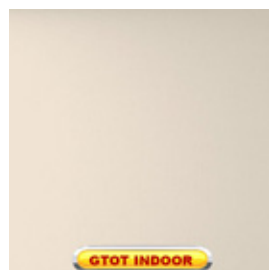


TR/510

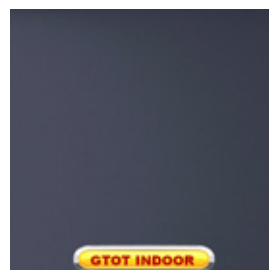


TR/511

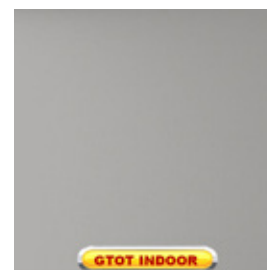


TR/512

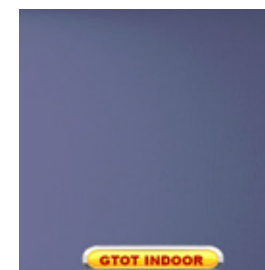


TR/520

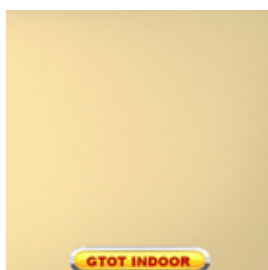


TR/522

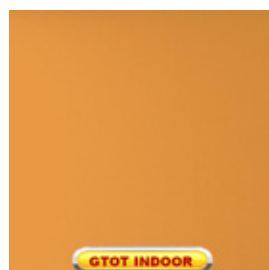


TR/523

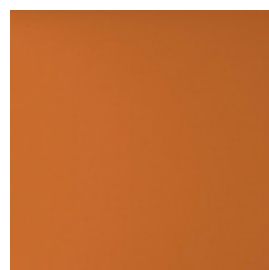


TR/524

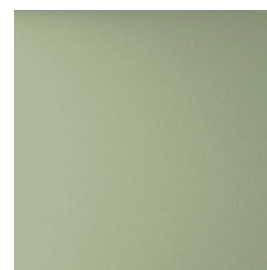


TR/526

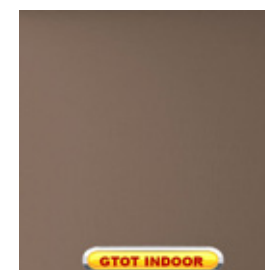


TR/527

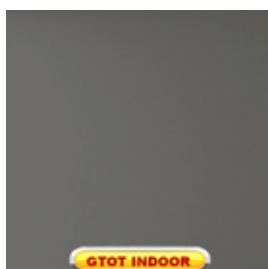


TR/528

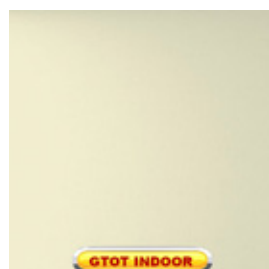

TR/529

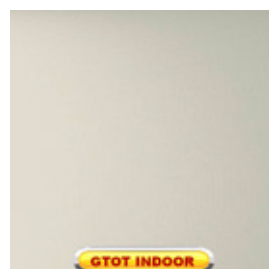

TR/531

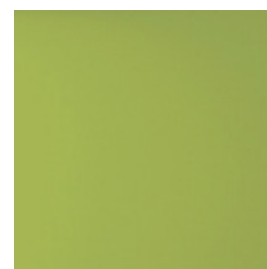

Name	Cat.	Ref.																									
Reference Standard							UNI EN ISO 2286-2	UNI EN ISO 2286-3	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	EN ISO 11654	UNI EN ISO 1421	UNI EN ISO 1421	UNI EN ISO 105 B02			

Blackout TR F.R.	TR	TR/501	100% PL	Classe 1 (I), M1 (F), B1 (D), EN 13501-1 B-s2,d0	OEKO-TEX	240	340	0,38	0		0	66	34	0	79	0,35					100		85	52,5	5/6		heat
Blackout TR F.R.	TR	TR/502	100% PL			240	340	0,38	0		0	70	30	0	83	0,35					100		85	52,5	5/6		heat
Blackout TR F.R.	TR	TR/510	100% PL			240	340	0,38	0		0	72	28	0	84	0,34					100		85	52,5	5/6		heat
Blackout TR F.R.	TR	TR/511	100% PL			240	340	0,38	0		0	69	31	0	82	0,35					100		85	52,5	5/6		heat
Blackout TR F.R.	TR	TR/512	100% PL			240	340	0,38	0		0	70	30	0	82	0,34					100		85	52,5	5/6		heat
Blackout TR F.R.	TR	TR/520	100% PL			240	340	0,38	0		0	72	28	0	84	0,34					100		85	52,5	5/6		heat
Blackout TR F.R.	TR	TR/522	100% PL			240	340	0,38	0		0	69	31	0	82	0,35					100		85	52,5	5/6		heat
Blackout TR F.R.	TR	TR/523	100% PL			240	340	0,38	0		0	71	29	0	83	0,36					100		85	52,5	5/6		heat
Blackout TR F.R.	TR	TR/524	100% PL			240	340	0,38	0		0	71	29	0	82	0,36					100		85	52,5	5/6		heat

All coefficients have a possible tolerance of +/- 5%
Attention: colour shades may vary slightly from one dye lot to another



Width



Composition



Health certification



IMO - Fabrics for marine industry



Solar reflection



Light absorption



Sound absorption



Thickness



Flame retardant



Colour fastness



Openess factor



Solar absorption



G tot Type C - GLASS



Warp - Weft N5 cm



Weight



Transparency



Sealable



Solar transmission



Light transmission



UV reduction



Glare control

MAINTENANCE HANDLE THE FABRIC WITH CARE, USING CLEAN DRY HANDS. DO NOT USE SOLVENTS OR ANY ABRASIVE SUBSTANCES THAT MAY DAMAGE THE FABRIC. WHEN CLEANING WINDOWS THE BLIND MUST BE RAISED TO AVOID ANY DIRECT OR INDIRECT SPRAY OF CLEANING PRODUCTS. REMOVE THE DUST WITH A VACUUM CLEANER OR USING COMPRESSED AIR, AVOID PULLING OR STRETCHING FABRIC. ONLY FOR PVC COATED PRODUCTS, CLEAN WITH A DAMP CLOTH OR A SPONGE DIPPED IN SOAPY WATER IF NECESSARY. RINSE WITH CLEAN WATER. DO NOT RUB. LEAVE THE BLIND DOWN UNTIL COMPLETELY DRY.

Name	Cat.	Ref.																									
Reference Standard							UNI EN ISO 2286-2	UNI EN ISO 2286-3	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	EN ISO 11654	UNI EN ISO 1421	UNI EN ISO 1421	UNI EN ISO 105 B02			

Blackout TR F.R.	TR	TR/526	100% PL	Classe 1 (I), M1 (F), B1 (D), EN 13501-1 B-s2,d0	OEKO-TEX	240	340	0,38	0		0	71	29	0	83	0,34					100		85	52,5	5/6		heat
Blackout TR F.R.	TR	TR/527	100% PL			240	340	0,38	0		0	71	29	0	83	0,33					100		85	52,5	5/6		heat
Blackout TR F.R.	TR	TR/528	100% PL			240	340	0,38	0		0	73	27	0	85	0,35					100		85	52,5	5/6		heat
Blackout TR F.R.	TR	TR/529	100% PL			240	340	0,38	0		0	71	29	0	83	0,34					100		85	52,5	5/6		heat
Blackout TR F.R.	TR	TR/531	100% PL			240	340	0,38	0		0	71	29	0	83	0,36					100		85	52,5	5/6		heat

All coefficients have a possible tolerance of +/- 5%
Attention: colour shades may vary slightly from one dye lot to another


Width


Composition


Health certification


IMO - Fabrics for marine industry


Solar reflection


Light absorption


Sound absorption


Thickness


Flame retardant


Colour fastness


Openess factor


Solar absorption


G tot Type C - GLASS


Warp - Weft N5 cm


Weight


Transparency


Sealable


Solar transmission


Light transmission


UV reduction


Glare control

MAINTENANCE HANDLE THE FABRIC WITH CARE, USING CLEAN DRY HANDS. DO NOT USE SOLVENTS OR ANY ABRASIVE SUBSTANCES THAT MAY DAMAGE THE FABRIC. WHEN CLEANING WINDOWS THE BLIND MUST BE RAISED TO AVOID ANY DIRECT OR INDIRECT SPRAY OF CLEANING PRODUCTS. REMOVE THE DUST WITH A VACUUM CLEANER OR USING COMPRESSED AIR, AVOID PULLING OR STRETCHING FABRIC. ONLY FOR PVC COATED PRODUCTS, CLEAN WITH A DAMP CLOTH OR A SPONGE DIPPED IN SOAPY WATER IF NECESSARY. RINSE WITH CLEAN WATER. DO NOT RUB. LEAVE THE BLIND DOWN UNTIL COMPLETELY DRY.