



Domino 1 Blackout F.R.




DF1B/R01-300

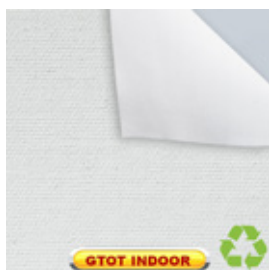


DF1B/R02-300

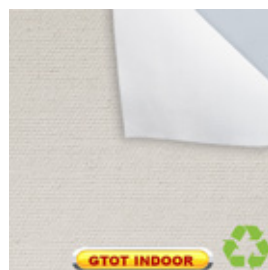


DF1B/R03-300

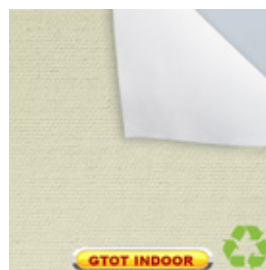


DF1B/R04-300

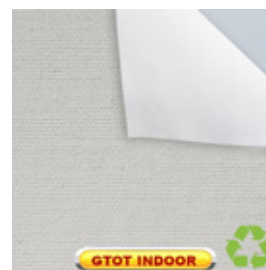

DF1B/R05-300

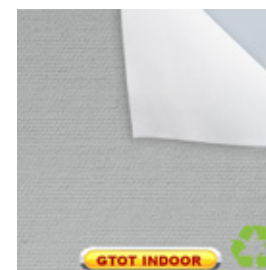

DF1B/R06-300

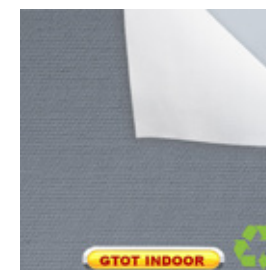


DF1B/C02-300




DF1B/C04-300




DF1B/C05-300

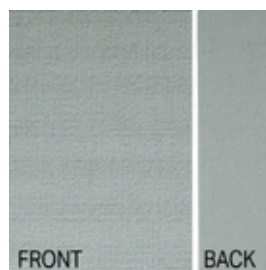


DF1B/C06-300

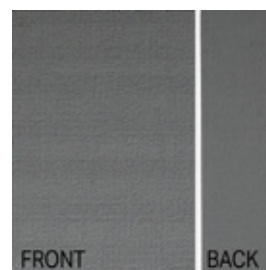

DF1B/C07-300

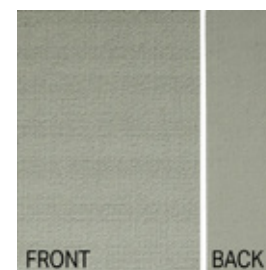

DF1B/C08-300

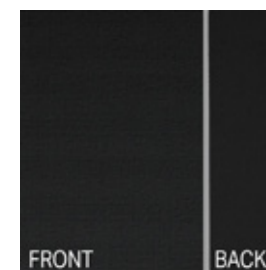

Name	Cat.	Ref.																									
Reference Standard							UNI EN ISO 2286-2	UNI EN ISO 2286-3	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	EN ISO 11654	UNI EN ISO 1421	UNI EN ISO 1421	UNI EN ISO 105 B02			

Domino 1 Blackout F.R.	DF1B	DF1B/R01-300	100% Recycled PL	Classe 1 (I), B1(D)	OEKO-TEX REACH  RECYCLED	300	420	0,55			0	71	29	0	84	0,34					100				6/7		
Domino 1 Blackout F.R.	DF1B	DF1B/R02-300	100% Recycled PL	Classe 1 (I), B1(D)		300	420	0,55			0	71	29	0	84	0,34					100				6/7		
Domino 1 Blackout F.R.	DF1B	DF1B/R03-300	100% Recycled PL	Classe 1 (I), B1(D)		300	420	0,55			0	71	29	0	84	0,34					100				6/7		
Domino 1 Blackout F.R.	DF1B	DF1B/R04-300	100% Recycled PL	Classe 1 (I), B1(D)		300	420	0,55			0	71	29	0	84	0,34					100				6/7		
Domino 1 Blackout F.R.	DF1B	DF1B/R05-300	100% Recycled PL	Classe 1 (I), B1(D)		300	420	0,55			0	71	29	0	84	0,34					100				6/7		
Domino 1 Blackout F.R.	DF1B	DF1B/R06-300	100% Recycled PL	Classe 1 (I), B1(D)		300	420	0,55			0	71	29	0	84	0,34					100				6/7		

All coefficients have a possible tolerance of +/- 5%
Attention: colour shades may vary slightly from one dye lot to another


Width


Composition


Health certification


IMO - Fabrics for marine industry


Solar reflection


Light absorption


Sound absorption


Thickness


Flame retardant


Colour fastness


Openess factor


Solar absorption


G tot Type C - GLASS


Warp - Weft N5 cm


Weight


Transparency


Sealable


Solar transmission


Light transmission


UV reduction


Glare control

MAINTENANCE HANDLE THE FABRIC WITH CARE, USING CLEAN DRY HANDS. DO NOT USE SOLVENTS OR ANY ABRASIVE SUBSTANCES THAT MAY DAMAGE THE FABRIC. WHEN CLEANING WINDOWS THE BLIND MUST BE RAISED TO AVOID ANY DIRECT OR INDIRECT SPRAY OF CLEANING PRODUCTS. REMOVE THE DUST WITH A VACUUM CLEANER OR USING COMPRESSED AIR, AVOID PULLING OR STRETCHING FABRIC. ONLY FOR PVC COATED PRODUCTS, CLEAN WITH A DAMP CLOTH OR A SPONGE DIPPED IN SOAPY WATER IF NECESSARY. RINSE WITH CLEAN WATER. DO NOT RUB. LEAVE THE BLIND DOWN UNTIL COMPLETELY DRY.

Name	Cat.	Ref.																									
Reference Standard							UNI EN ISO 2286-2	UNI EN ISO 2286-3	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	EN ISO 11654	UNI EN ISO 1421	UNI EN ISO 1421	UNI EN ISO 105 B02			

Domino 1 Blackout Colour F.R.	DF1B	DF1B/C02-300	100% PL	Classe 1 (I), M1 (F); B1(D),BS(GB); NFPA 701 (US); EN 13773	OEKO-TEX REACH	300	400	0,45			0	68	32	0	71	0,36					100				6/7		
Domino 1 Blackout Colour F.R.	DF1B	DF1B/C04-300	100% PL			300	400	0,45			0	65	35	0	66	0,37					100				6/7		
Domino 1 Blackout Colour F.R.	DF1B	DF1B/C05-300	100% PL			300	400	0,45			0	52	48	0	52	0,43					100				6/7		
Domino 1 Blackout Colour F.R.	DF1B	DF1B/C06-300	100% PL			300	400	0,45			0	26	74	0	28	0,55					100				6/7		
Domino 1 Blackout Colour F.R.	DF1B	DF1B/C07-300	100% PL			300	400	0,45			0	49	51	0	51	0,44					100				6/7		
Domino 1 Blackout Colour F.R.	DF1B	DF1B/C08-300	100% PL			300	400	0,45			0	5	95	0	5	0,64					100				6/7		

All coefficients have a possible tolerance of +/- 5%
Attention: colour shades may vary slightly from one dye lot to another


Width


Composition


Health certification


IMO - Fabrics for marine industry


Solar reflection


Light absorption


Sound absorption


Thickness


Flame retardant


Colour fastness


Openess factor


Solar absorption


G tot Type C - GLASS


Warp - Weft N5 cm


Weight


Transparency


Sealable


Solar transmission


Light transmission


UV reduction


Glare control

MAINTENANCE HANDLE THE FABRIC WITH CARE, USING CLEAN DRY HANDS. DO NOT USE SOLVENTS OR ANY ABRASIVE SUBSTANCES THAT MAY DAMAGE THE FABRIC. WHEN CLEANING WINDOWS THE BLIND MUST BE RAISED TO AVOID ANY DIRECT OR INDIRECT SPRAY OF CLEANING PRODUCTS. REMOVE THE DUST WITH A VACUUM CLEANER OR USING COMPRESSED AIR, AVOID PULLING OR STRETCHING FABRIC. ONLY FOR PVC COATED PRODUCTS, CLEAN WITH A DAMP CLOTH OR A SPONGE DIPPED IN SOAPY WATER IF NECESSARY. RINSE WITH CLEAN WATER. DO NOT RUB. LEAVE THE BLIND DOWN UNTIL COMPLETELY DRY.