


Screen P40 F.R.



P/401-300

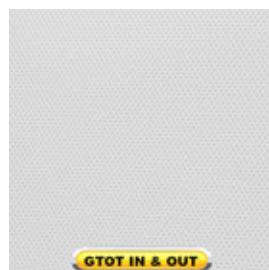

P/402-300




P/403-300




P/405-300



P/406-300

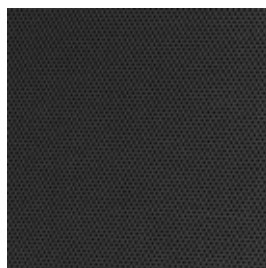

P/407-300

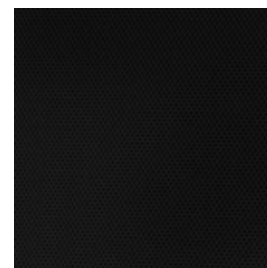

Name	Cat.	Ref.																									
Reference Standard							UNI EN ISO 2286-2	UNI EN ISO 2286-3	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	EN ISO 11654	UNI EN ISO 1421	UNI EN ISO 1421	UNI EN ISO 105 B02		

Screen P40 F.R.	P40	P/401-300	25%PL 75% PVC	Classe 1 (I), B1 (D), NFPA 701 (US), BS (GB)	 FUNGISTATIC  GREENGUARD  OEKO-TEX  REACH	300	520	0,63	0,5		14	74	12	10	85	0,33	0,10	0,24	0,07	2	100		220	155	8	✓	heat
Screen P40 F.R.	P40	P/402-300	25%PL 75% PVC			300	520	0,63	0,5		9	62	29	4	69	0,37	0,09	0,25	0,06	2	100		220	155	8	✓	heat
Screen P40 F.R.	P40	P/403-300	25%PL 75% PVC			300	520	0,63	0,5		4	49	47	2	58	0,41	0,07	0,26	0,06	3	100		220	155	8	✓	heat
Screen P40 F.R.	P40	P/405-300	25%PL 75% PVC			300	520	0,63	0,5		0	6	94	0	6	0,55	0,08	0,30	0,08	4	100		220	155	8	✓	heat
Screen P40 F.R.	P40	P/406-300	25%PL 75% PVC			300	520	0,63	0,5		0	7	93	0	7	0,55	0,08	0,30	0,08	4	100		220	155	8	✓	heat
Screen P40 F.R.	P40	P/407-300	25%PL 75% PVC			300	520	0,63	0,5		0	4	96	0	4	0,55	0,08	0,31	0,08	4	100		220	155	8	✓	heat

All coefficients have a possible tolerance of +/- 5%
Attention: colour shades may vary slightly from one dye lot to another

	Width		Composition		Health certification		IMO - Fabrics for marine industry		Solar reflection		Light absorption		Sound absorption
	Thickness		Flame retardant		Colour fastness		Openess factor		Solar absorption		G tot Type C - GLASS		Warp - Weft N5 cm
	Weight		Transparency		Sealable		Solar transmission		Light transmission		UV reduction		Glare control

MAINTENANCE HANDLE THE FABRIC WITH CARE, USING CLEAN DRY HANDS. DO NOT USE SOLVENTS OR ANY ABRASIVE SUBSTANCES THAT MAY DAMAGE THE FABRIC. WHEN CLEANING WINDOWS THE BLIND MUST BE RAISED TO AVOID ANY DIRECT OR INDIRECT SPRAY OF CLEANING PRODUCTS. REMOVE THE DUST WITH A VACUUM CLEANER OR USING COMPRESSED AIR, AVOID PULLING OR STRETCHING FABRIC. ONLY FOR PVC COATED PRODUCTS, CLEAN WITH A DAMP CLOTH OR A SPONGE DIPPED IN SOAPY WATER IF NECESSARY. RINSE WITH CLEAN WATER. DO NOT RUB. LEAVE THE BLIND DOWN UNTIL COMPLETELY DRY.