



Screen P55 F.R.



P/551

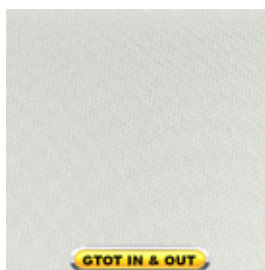


P/552

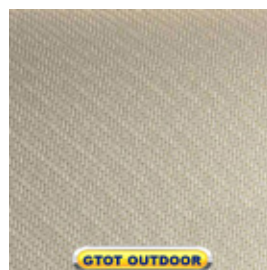


P/553



P/554

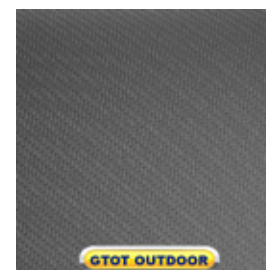

P/555

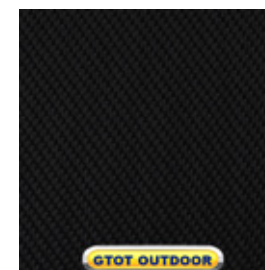

Name	Cat.	Ref.																									
Reference Standard							UNI EN ISO 2286-2	UNI EN ISO 2286-3	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	EN ISO 11654	UNI EN ISO 1421	UNI EN ISO 1421	UNI EN ISO 105 B02		
Screen P55 F.R.	P55	P/551	25% PL 75% PVC	Classe 1 (I), NFPA 701 (US), BS (GB)	 FUNGISTATIC  GREENGUARD GOLD  OEKO-TEX  REACH	300	630	0,83	3		17	71	12	14	82	0,34	0,12	0,25	0,08	1	95		125	167	8	✓	heat
Screen P55 F.R.	P55	P/552	25% PL 75% PVC			300	630	0,83	3		14	49	37	9	52	0,41	0,12	0,27	0,09	0	97		125	167	8	✓	heat
Screen P55 F.R.	P55	P/553	25% PL 75% PVC			300	630	0,83	3		8	34	58	5	38	0,46	0,10	0,28	0,08	3	97		125	167	8	✓	heat
Screen P55 F.R.	P55	P/554	25% PL 75% PVC			300	630	0,83	3		5	12	83	4	13	0,53	0,11	0,30	0,09	4	96		125	167	8	✓	heat
Screen P55 F.R.	P55	P/555	25% PL 75% PVC			300	630	0,83	3		4	3	93	4	3	0,56	0,11	0,31	0,09	3	96		125	167	8	✓	heat

All coefficients have a possible tolerance of +/- 5%
 Attention: colour shades may vary slightly from one dye lot to another



Width



Composition



Health certification



IMO - Fabrics for marine industry



Solar reflection



Light absorption



Sound absorption



Thickness



Flame retardant



Colour fastness



Openess factor



Solar absorption



G tot Type C - GLASS



Warp - Weft N5 cm



Weight



Transparency



Sealable



Solar transmission



Light transmission



UV reduction



Glare control

MAINTENANCE HANDLE THE FABRIC WITH CARE, USING CLEAN DRY HANDS. DO NOT USE SOLVENTS OR ANY ABRASIVE SUBSTANCES THAT MAY DAMAGE THE FABRIC. WHEN CLEANING WINDOWS THE BLIND MUST BE RAISED TO AVOID ANY DIRECT OR INDIRECT SPRAY OF CLEANING PRODUCTS. REMOVE THE DUST WITH A VACUUM CLEANER OR USING COMPRESSED AIR, AVOID PULLING OR STRETCHING FABRIC. ONLY FOR PVC COATED PRODUCTS, CLEAN WITH A DAMP CLOTH OR A SPONGE DIPPED IN SOAPY WATER IF NECESSARY. RINSE WITH CLEAN WATER. DO NOT RUB. LEAVE THE BLIND DOWN UNTIL COMPLETELY DRY.