



SOLTIS 99 F.R.



S99/441

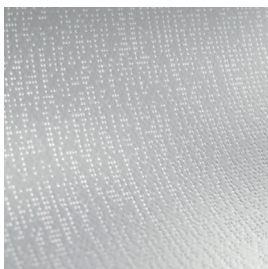

S99/442

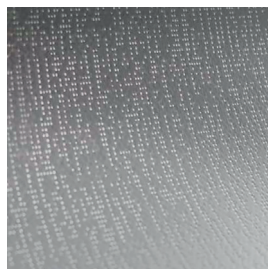

S99/443




S99/444-177





S99/441	267	0,32	290	40% PL 60% PVC	Euroclass B-s2,d0 (EU) Classe 1 (I), M1 (F), B1 (D), BS (GB), NFPA 701 (US), G1 (RU), VKF (CH)	Low Transparent	GREENGUARD GOLD, RECYCLABLE	heat	No	3.00	13	54	33	12	0,34	160	170
S99/442	267	0,32	290	40% PL 60% PVC	Euroclass B-s2,d0 (EU) Classe 1 (I), M1 (F), B1 (D), BS (GB), NFPA 701 (US), G1 (RU), VKF (CH)	Low Transparent	GREENGUARD GOLD, RECYCLABLE	heat	No	3.00	8	44	48	6	0,43	160	170
S99/443	267	0,32	290	40% PL 60% PVC	Euroclass B-s2,d0 (EU) Classe 1 (I), M1 (F), B1 (D), BS (GB), NFPA 701 (US), G1 (RU), VKF (CH)	Low Transparent	GREENGUARD GOLD, RECYCLABLE	heat	No	3.00	4	40	56	3	0,40	160	170
S99/444-177	177	0,32	290	40% PL 60% PVC	Euroclass B-s2,d0 (EU) Classe 1 (I), M1 (F), B1 (D), BS (GB), NFPA 701 (US), G1 (RU), VKF (CH)	Low Transparent	GREENGUARD GOLD, RECYCLABLE	heat	No	3.00	8	62	30	7	0,37	160	170

All coefficients have a possible tolerance of +/- 5%
 Attention: colour shades may vary slightly from one dye lot to another

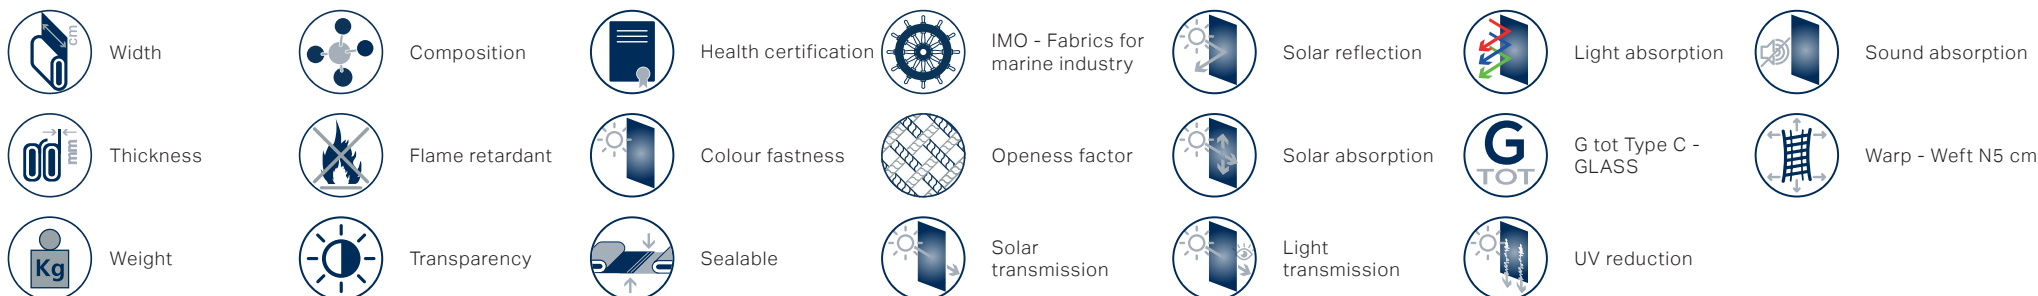

MAINTENANCE HANDLE THE FABRIC WITH CARE, USING CLEAN DRY HANDS. DO NOT USE SOLVENTS OR ANY ABRASIVE SUBSTANCES THAT MAY DAMAGE THE FABRIC. WHEN CLEANING WINDOWS THE BLIND MUST BE RAISED TO AVOID ANY DIRECT OR INDIRECT SPRAY OF CLEANING PRODUCTS. REMOVE THE DUST WITH A VACUUM CLEANER OR USING COMPRESSED AIR, AVOID PULLING OR STRETCHING FABRIC. ONLY FOR PVC COATED PRODUCTS, CLEAN WITH A DAMP CLOTH OR A SPONGE DIPPED IN SOAPY WATER IF NECESSARY. RINSE WITH CLEAN WATER. DO NOT RUB. LEAVE THE BLIND DOWN UNTIL COMPLETELY DRY.