

Soltis B92 Blackout F.R.




SL/771



SL/772




SL/774

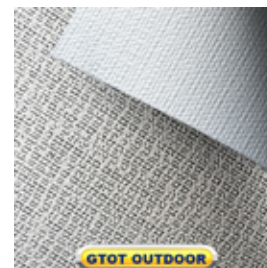


SL/785



SL/786

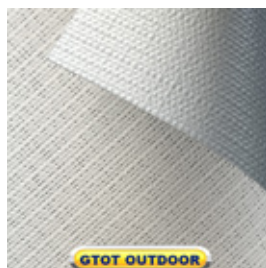


SL/787

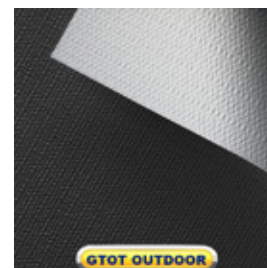

Name	Cat.	Ref.	Composition	F.R. classification	Health certifications	Width cm	Weight g/m2	Thickness mm	OF %	Shading	TS %	RS %	AS %	TL %	RL %	INT Type C glass	EXT Type C glass	INT Type D glass	EXT Type D glass	Glare control	↓UV %	αw	Mechanical resistance WARP daN/5cm	Mechanical resistance WEFT daN/5cm	Colour fastness to light	OUTDOOR	Sealable
Reference Standard							UNI EN ISO 2286-2	UNI EN ISO 2286-3	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	EN ISO 11654	UNI EN ISO 1421	UNI EN ISO 1421	UNI EN ISO 105 B02		

Soltis B92 Blackout F.R.	SL	SL/771	27% PL 73% PVC	Euroclass B-s,d0 (EU), Classe 2 (I), B1 (D), BS (GB), NFPA 701(US), VKF (CH), EN 13773 Class 1(EU) G1 (RU)	GREENGUARD GOLD RECYCLABLE	170	650	0,60	0	●	0	70	30	0		0,22	0,03	0,27	0,01		100		310	210		✓	heat	
Soltis B92 Blackout F.R.	SL	SL/772	27% PL 73% PVC			170	650	0,60	0	●	0	13	87	0			0,43	0,01	0,28	0,02		100		310	210		✓	heat
Soltis B92 Blackout F.R.	SL	SL/774	27% PL 73% PVC			170	650	0,60	0	●	0	38	62	0			0,39	0,02	0,19	0,02		100		310	210		✓	heat
Soltis B92 Blackout F.R.	SL	SL/785	27% PL 73% PVC			170	650	0,60	0	●	0	47	53	0			0,36	0,02	0,18	0,02		100		310	210		✓	heat
Soltis B92 Blackout F.R.	SL	SL/786	27% PL 73% PVC			170	650	0,60	0	●	0	45	55	0			0,37	0,02	0,18	0,02		100		310	210		✓	heat
Soltis B92 Blackout F.R.	SL	SL/787	27% PL 73% PVC			170	650	0,60	0	●	0	6	94	0			0,53	0,02	0,28	0,02		100		310	210		✓	heat

All coefficients have a possible tolerance of +/- 5%
Attention: colour shades may vary slightly from one dye lot to another

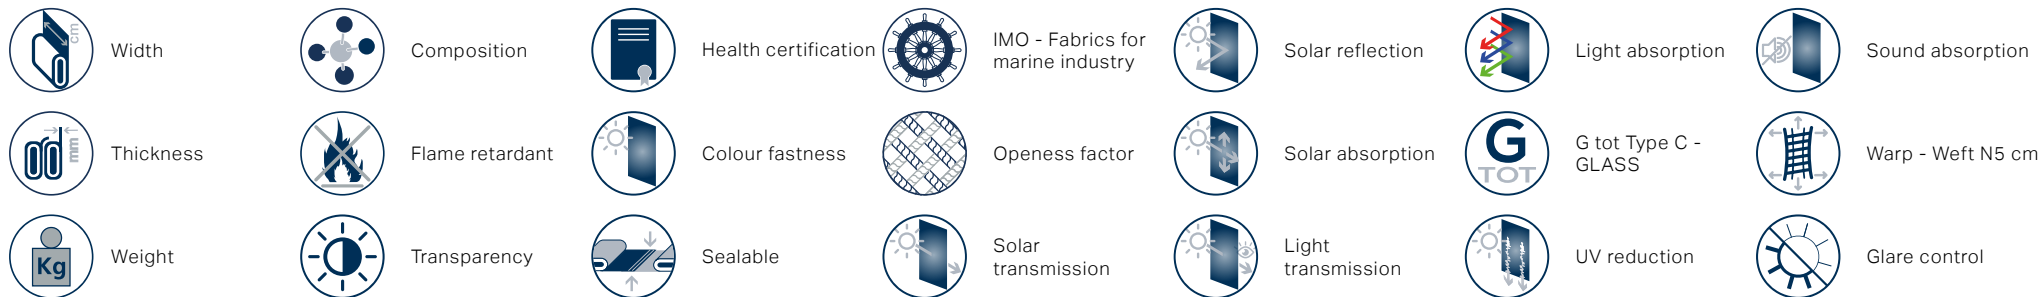

MAINTENANCE HANDLE THE FABRIC WITH CARE, USING CLEAN DRY HANDS. DO NOT USE SOLVENTS OR ANY ABRASIVE SUBSTANCES THAT MAY DAMAGE THE FABRIC. WHEN CLEANING WINDOWS THE BLIND MUST BE RAISED TO AVOID ANY DIRECT OR INDIRECT SPRAY OF CLEANING PRODUCTS. REMOVE THE DUST WITH A VACUUM CLEANER OR USING COMPRESSED AIR, AVOID PULLING OR STRETCHING FABRIC. ONLY FOR PVC COATED PRODUCTS, CLEAN WITH A DAMP CLOTH OR A SPONGE DIPPED IN SOAPY WATER IF NECESSARY. RINSE WITH CLEAN WATER. DO NOT RUB. LEAVE THE BLIND DOWN UNTIL COMPLETELY DRY.