

Gala F.R.



GA/01



GA/02



GA/03




GA/04



GA/05



GA/06

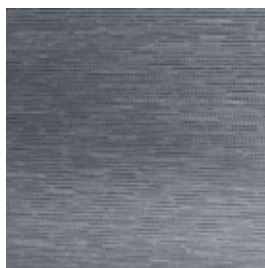


GA/07



GA/08



GA/09

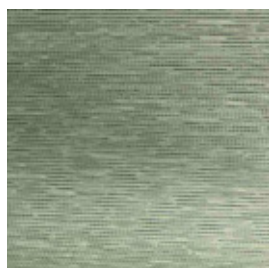


GA/10



GA/11



GA/12

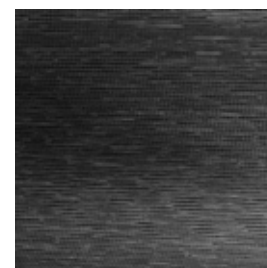

Name	Cat.	Ref.																									
Reference Standard							UNI EN ISO 2286-2	UNI EN ISO 2286-3	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	EN ISO 11654	UNI EN ISO 1421	UNI EN ISO 1421	UNI EN ISO 105 B02			

Gala F.R.	GA	GA/01	100% PL Trevira CS	Classe1 (I), M1(F), B1(D), BS (GB), EN 13773 Class1(EU)	 EU ECOLABEL OEKO-TEX	300	200	0,40	4		35	38	27	35		0,47					73				5/7		
Gala F.R.	GA	GA/02	100% PL Trevira CS			300	200	0,40	4		33	38	29	33		0,47					77				5/7		
Gala F.R.	GA	GA/03	100% PL Trevira CS			300	200	0,40	4		32	34	34	29		0,48					78				5/7		
Gala F.R.	GA	GA/04	100% PL Trevira CS			300	200	0,40	4		24	31	45	15		0,49					88				5/7		
Gala F.R.	GA	GA/05	100% PL Trevira CS			300	200	0,40	4		30	34	36	24		0,48					80				5/7		
Gala F.R.	GA	GA/06	100% PL Trevira CS			300	200	0,40	4		28	31	41	20		0,49					81				5/7		

All coefficients have a possible tolerance of +/- 5%
Attention: colour shades may vary slightly from one dye lot to another


Width


Composition


Health certification


IMO - Fabrics for marine industry


Solar reflection


Light absorption


Sound absorption


Thickness


Flame retardant


Colour fastness


Openess factor


Solar absorption


G tot Type C - GLASS


Warp - Weft N5 cm


Weight


Transparency


Sealable


Solar transmission


Light transmission


UV reduction


Glare control

MAINTENANCE HANDLE THE FABRIC WITH CARE, USING CLEAN DRY HANDS. DO NOT USE SOLVENTS OR ANY ABRASIVE SUBSTANCES THAT MAY DAMAGE THE FABRIC. WHEN CLEANING WINDOWS THE BLIND MUST BE RAISED TO AVOID ANY DIRECT OR INDIRECT SPRAY OF CLEANING PRODUCTS. REMOVE THE DUST WITH A VACUUM CLEANER OR USING COMPRESSED AIR, AVOID PULLING OR STRETCHING FABRIC. ONLY FOR PVC COATED PRODUCTS, CLEAN WITH A DAMP CLOTH OR A SPONGE DIPPED IN SOAPY WATER IF NECESSARY. RINSE WITH CLEAN WATER. DO NOT RUB. LEAVE THE BLIND DOWN UNTIL COMPLETELY DRY.

Name	Cat.	Ref.	 Composition	 F.R. classification	 Health certifications	 Width cm	 Weight g/m2	 Thickness mm	 OF %	 Shading	 TS %	 RS %	AS %	TL %	RL %	INT Type C glass	EXT Type C glass	INT Type D glass	EXT Type D glass	Glare control	↓UV %	αω	Mechanical resistance WARP daN/5cm	Mechanical resistance WEFT daN/5cm	Colour fastness to light	OUTDOOR	Sealable
Reference Standard							UNI EN ISO 2286-2	UNI EN ISO 2286-3	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	EN ISO 11654	UNI EN ISO 1421	UNI EN ISO 1421	UNI EN ISO 105 B02		

Gala F.R.	GA	GA/07	100% PL Trevira CS	Classe1 (I), M1(F), B1(D), BS (GB), EN 13773 Class1(EU)	 EU ECOLABEL	OEKO-TEX	300	200	0,40	4		28	33	39	21		0,48					82			5/7			
Gala F.R.	GA	GA/08	100% PL Trevira CS				300	200	0,40	4		27	34	39	22		0,48						81			5/7		
Gala F.R.	GA	GA/09	100% PL Trevira CS				300	200	0,40	4		31	31	38	24		0,49						79			5/7		
Gala F.R.	GA	GA/10	100% PL Trevira CS				300	200	0,40	4		20	28	52	11		0,49						89			5/7		
Gala F.R.	GA	GA/11	100% PL Trevira CS				300	200	0,40	4		21	25	54	10		0,50						89			5/7		
Gala F.R.	GA	GA/12	100% PL Trevira CS				300	200	0,40	4		17	25	58	6		0,50						93			5/7		

All coefficients have a possible tolerance of +/- 5%
Attention: colour shades may vary slightly from one dye lot to another



Width



Composition



Health certification



IMO - Fabrics for
marine industry



Solar reflection



Light absorption



Sound absorption



Thickness



Flame retardant



Colour fastness



Openness factor



Solar absorption



G tot Type C -
GLASS



Warp - Weft N5 cm



Weight



Transparency



Sealable



Solar
transmission



Light
transmission



UV reduction



Glare control

MAINTENANCE HANDLE THE FABRIC WITH CARE, USING CLEAN DRY HANDS. DO NOT USE SOLVENTS OR ANY ABRASIVE SUBSTANCES THAT MAY DAMAGE THE FABRIC. WHEN CLEANING WINDOWS THE BLIND MUST BE RAISED TO AVOID ANY DIRECT OR INDIRECT SPRAY OF CLEANING PRODUCTS. REMOVE THE DUST WITH A VACUUM CLEANER OR USING COMPRESSED AIR, AVOID PULLING OR STRETCHING FABRIC. ONLY FOR PVC COATED PRODUCTS, CLEAN WITH A DAMP CLOTH OR A SPONGE DIPPED IN SOAPY WATER IF NECESSARY. RINSE WITH CLEAN WATER. DO NOT RUB. LEAVE THE BLIND DOWN UNTIL COMPLETELY DRY.