



Blackout LS F.R.




LS/201

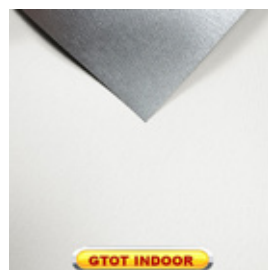


LS/202

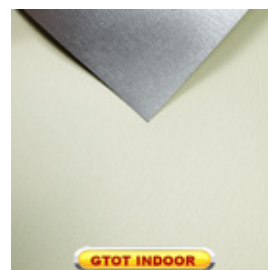


LS/203

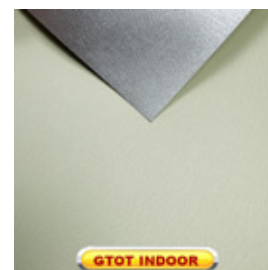


LS/204

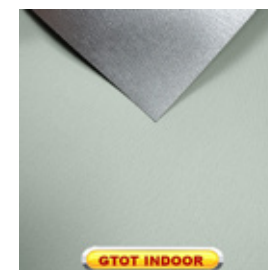

LS/205

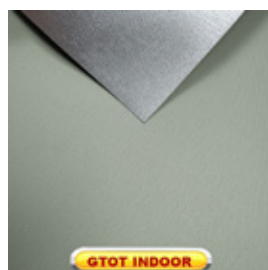



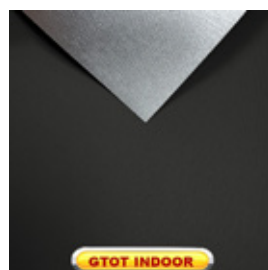


















LS/206



Name	Cat.	Ref.	Composition	F.R. classification	Health certifications	Width cm	Weight g/m ²	Thickness mm	OF %	Shading	TS %	RS %	AS %	TL %	RL %	INT Type C glass	EXT Type C glass	INT Type D glass	EXT Type D glass	Glare control	↓UV %	αω	Mechanical resistance WARP daN/5cm	Mechanical resistance WEFT daN/5cm	Colour fastness to light	OUTDOOR	Sealable
Reference Standard							UNI EN ISO 2286-2	UNI EN ISO 2286-3	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	UNI EN 14501	EN ISO 11654	UNI EN ISO 1421	UNI EN ISO 1421	UNI EN ISO 105 B02		

Blackout LS F.R.	LS	LS/201	66% PL 34% PU	Classe 1 (I), M1 (F), B1 (D), BS (GB), NFPA 701 (US), EN 13773 Class 1 (EU),	GREENGUARD	260	344	0,30	0	●	0	66	34	0	67	0,30		0,14		4	100		120	142	4	with tape using high frequency
Blackout LS F.R.	LS	LS/202	66% PL 34% PU			260	344	0,30	0	●	0	70	30	0	69	0,28		0,13		4	100		120	142	4	
Blackout LS F.R.	LS	LS/203	66% PL 34% PU			260	344	0,30	0	●	0	74	26	0	75	0,26		0,11		4	100		120	142	4	
Blackout LS F.R.	LS	LS/204	66% PL 34% PU			260	344	0,30	0	●	0	64	36	0	67	0,31		0,14		4	100		120	142	4	
Blackout LS F.R.	LS	LS/205	66% PL 34% PU			260	344	0,30	0	●	0	63	37	0	62	0,32		0,15		4	100		120	142	4	
Blackout LS F.R.	LS	LS/206	66% PL 34% PU			260	344	0,30	0	●	0	67	33	0	67	0,30		0,14		4	100		120	142	4	

All coefficients have a possible tolerance of +/- 5%
Attention: colour shades may vary slightly from one dye lot to another

 Width	 Composition	 Health certification	 IMO - Fabrics for marine industry	 Solar reflection	 Light absorption	 Sound absorption
 Thickness	 Flame retardant	 Colour fastness	 Openess factor	 Solar absorption	 G tot Type C - GLASS	 Warp - Weft N5 cm
 Weight	 Transparency	 Sealable	 Solar transmission	 Light transmission	 UV reduction	 Glare control

MAINTENANCE HANDLE THE FABRIC WITH CARE, USING CLEAN DRY HANDS. DO NOT USE SOLVENTS OR ANY ABRASIVE SUBSTANCES THAT MAY DAMAGE THE FABRIC. WHEN CLEANING WINDOWS THE BLIND MUST BE RAISED TO AVOID ANY DIRECT OR INDIRECT SPRAY OF CLEANING PRODUCTS. REMOVE THE DUST WITH A VACUUM CLEANER OR USING COMPRESSED AIR, AVOID PULLING OR STRETCHING FABRIC. ONLY FOR PVC COATED PRODUCTS, CLEAN WITH A DAMP CLOTH OR A SPONGE DIPPED IN SOAPY WATER IF NECESSARY. RINSE WITH CLEAN WATER. DO NOT RUB. LEAVE THE BLIND DOWN UNTIL COMPLETELY DRY.