


Decoscreen 4 F.R.




DS/401

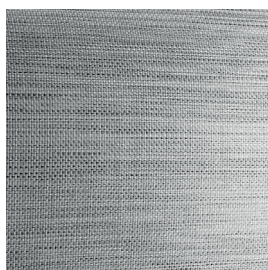


DS/402



DS/403

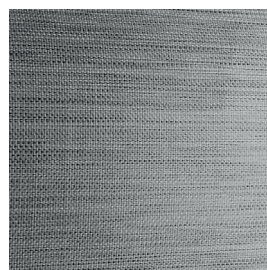

DS/404

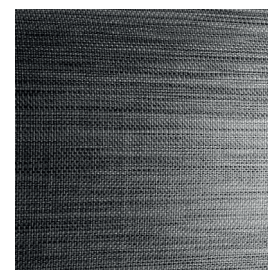

Ref.	 cm	 mm	 g/m²								 %					 INT	 WARP	 WEFT		
DS/401	250	0,35	385	36% FV 64% PVC	Euroclass C-s3-d0(EU), Classe 1 (I), M2 (F),BS (GB),NFPA 701 (US)	Low Transparent	GREENGUARD, OEKO-TEX	7	heat	No	5.00	19	46	35	18	20	0,42	89	160	160
DS/402	250	0,35	385	36% FV 64% PVC	Euroclass C-s3-d0(EU), Classe 1 (I), M2 (F),BS (GB),NFPA 701 (US)	Low Transparent	GREENGUARD, OEKO-TEX	7	heat	No	5.00	13	29	58	11	15	0,47	90	160	160
DS/403	250	0,35	385	36% FV 64% PVC	Euroclass C-s3-d0(EU), Classe 1 (I), M2 (F),BS (GB),NFPA 701 (US)	Low Transparent	GREENGUARD, OEKO-TEX	7	heat	No	5.00	14	31	55	12	17	0,47	90	160	160
DS/404	250	0,35	385	36% FV 64% PVC	Euroclass C-s3-d0(EU), Classe 1 (I), M2 (F),BS (GB),NFPA 701 (US)	Low Transparent	GREENGUARD, OEKO-TEX	7	heat	No	5.00	11	18	71	11	13	0,46	90	160	160

All coefficients have a possible tolerance of +/- 5%
Attention: colour shades may vary slightly from one dye lot to another

	Width		Composition		Health certification		IMO - Fabrics for marine industry		Solar reflection		Light absorption		Sound absorption
	Thickness		Flame retardant		Colour fastness		Openess factor		Solar absorption		G tot Type C - GLASS		Warp - Weft N5 cm
	Weight		Transparency		Sealable		Solar transmission		Light transmission		UV reduction		

MAINTENANCE HANDLE THE FABRIC WITH CARE, USING CLEAN DRY HANDS. DO NOT USE SOLVENTS OR ANY ABRASIVE SUBSTANCES THAT MAY DAMAGE THE FABRIC. WHEN CLEANING WINDOWS THE BLIND MUST BE RAISED TO AVOID ANY DIRECT OR INDIRECT SPRAY OF CLEANING PRODUCTS. REMOVE THE DUST WITH A VACUUM CLEANER OR USING COMPRESSED AIR, AVOID PULLING OR STRETCHING FABRIC. ONLY FOR PVC COATED PRODUCTS, CLEAN WITH A DAMP CLOTH OR A SPONGE DIPPED IN SOAPY WATER IF NECESSARY. RINSE WITH CLEAN WATER. DO NOT RUB. LEAVE THE BLIND DOWN UNTIL COMPLETELY DRY.